



05-08 Colorado / Canyon



1. Remove the trim around the speedometer.



2. The trim is only held in with clips, just pull out.



3. Remove the 4 7mm screws. Mark the needle locations on the diagram below. Leave key off.



4. Unplug the cluster.



5. Take the cluster inside to remove the gauge face.



6. Remove the screws on the back of the cluster.



7. Remove the lens.



8. Twist each needle down past the low marks. And remove.



9. Remove the stock gauge face.



10. On the back of the US Speedo gauge face is plastic liner, remove.



11. Place the gauge face in place and take back to the truck and plug in.



12. Turn the key forward, then off. Leave off. Put on cotton gloves for stainless.



13. Place the needles in place. Set each needle at 0 or low.



14. Do not push the needles all the way down yet.



15. Start the engine and watch the needles.



16. Turn off. Make sure the needles go back to 0 or low.



17. Take the cluster out and place on flat surface. Slide the handle of the needle tool under the hub of the needle and push down.



18. Plug the cluster back in.



19. Make sure the needles go back to 0 or low and install.

